



I Clutch

I clutch kit

I Fitting instruction

I Nissan Qashqai 1.6
I Nissan Tiida 1.6
I Nissan Micra K13 106SR

Correct fitting direction for disk of kit 826818

Description

The common practice for correct disk fitting positioning, when accommodates absorption mechanism, is the longer part of the mechanism to be towards the transmission line.


In the case of **kit 826818** (Original Equipment product), consists in a cover assembly of 215 mm diameter & a disk of 200 mm diameter, situation could be misleading. This is because disk hub spline extrudes towards flywheel side



Flywheel side of disk kit 826818



Gearbox side of disk kit 826818

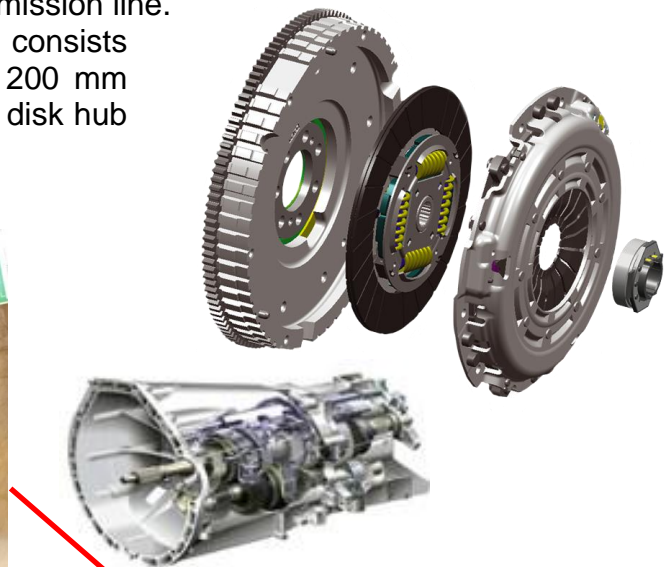


An easy rule of thumb, in order to avoid any mistake in any case for the correct fitting direction of the dampen disk, is this which directs springs retainer plate towards to the transmission line.

The use of appropriate centering tool for the correct disk fitting is mandatory and essential as well.

valeo
tech
centre

Springs retainer disk

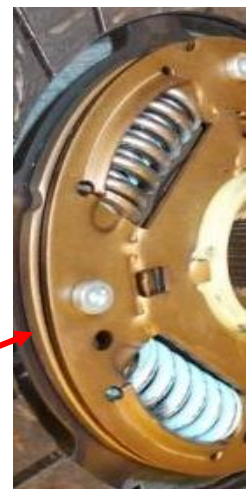

www.valeoservice.com

Valeo Service Export,
Liaison Office of Athens,
Kalamakiou 18 Avenue, Alimos - 17455
Tel. : + 30 210 98 58 944 - Fax : +30 210 45 27 449

Valeo
Service